

HAL - Hall Effect in a Plasma
Physics 111B: Advanced Experimentation Laboratory
University of California, Berkeley

Contents

1 Hall Effect in a Plasma Description (HAL)	2
2 Before the 1st Day of Lab	2
3 Hall Effect in a Plasma Pictures	3
4 The Hall Effect	4
5 Hall Effect in Glow Discharge Columns	6
6 Instabilities, Oscillations, and Striations	7
7 Apparatus and Equipment	8
8 Equipment Notes	8
8.1 General, the gas and the plasma	8
8.2 How to set a gas pressure and gas flow rate	9
8.3 How to set a gas pressure	9
9 Plasma Discharge and Associated Electrical Instruments	11
10 Procedure	11
10.1 Turning on the system	11
10.2 Shutting off the system	12
10.3 Measurements	13
10.4 Glow Discharge Structure	14
11 Hall Effect tube and magnet electronic diagram	15
12 Hall Effect Magnet Power Circuit Schematic	16
13 Suggested Reading	16
14 References	16

1 Hall Effect in a Plasma Description (HAL)

Last updated 2026-04-15 by Samara Steinfeld

Note that there is NO eating or drinking in the 111-Lab anywhere, except in rooms Physics 282 & 286 on the bench with the BLUE stripe around it.

1. Pre-requisites: None
2. Days Allotted for the Experiment: 5
3. Consecutive days: Yes

This lab will be graded 30% on theory, 20% on technique, and 50% on analysis.

Comments: E-mail [Dr Winthrop Williams](#)

Objectives:

- Understand how to generate a stable plasma for this apparatus.
- Measure the discharge current and discharge voltage as functions of the applied high voltage at different pressures.
- Understand hysteresis and how it contributes to the experiment.
- Measure the Hall voltage as a function of the magnetic field.
- Calculate and explain the characteristic qualities of the electron gas such as drift velocity, electron density, collision frequency, etc.

In low-density plasmas, such as the positive columns of glow discharges, the Hall effect is large and easily observable. In this experiment the Hall voltage across a helium discharge column is determined as a function of magnetic field, discharge current, and gas pressure. Electron drift velocities and densities are inferred from measurements of electrical parameters. A measurement of the resistance permits evaluation of the collision frequency of the electrons. The electron temperature can be calculated.

2 Before the 1st Day of Lab

Complete the HAL Pre Lab found in the [Signature Sheet](#) for this lab. Print the signature sheet, discuss the experiment and pre-lab questions and answers with any faculty member or GSI, and receive their signature. In the course of the lab there will be examination points where you must STOP and get a GSI or professor to verify your understanding and/or verify proper experimental setup. You cannot skip these checkpoints, and must receive signatures demonstrating that you've consulted the staff. Some experiments may have mid lab questions that must be completed by specific days of the experiment. The completed [Signature Sheet](#) MUST be submitted as the first page of your lab report. Quick links to the checkpoint questions are found here: [1](#) [2](#) [3](#) [4](#) [5](#)

1. *Note: In order to view the private Youtube videos hosted by the university, you must be signed into your berkeley.edu Google account.*
View the [Hall Effect in a Plasma Video](#).
2. Read about magnetic field [Hysteresis](#).
3. Last day of the experiment please fill out the [Experiment Evaluation](#)
4. Read W. B. Kunkel "Hall Effect In A Plasma", this should be your primary resource.

You should keep a laboratory notebook. The notebook should contain a detailed record of everything that was done and how/why it was done, as well as all of the data and analysis, also with plenty of how/why entries. This will aid you when you write your report.

3 Hall Effect in a Plasma Pictures

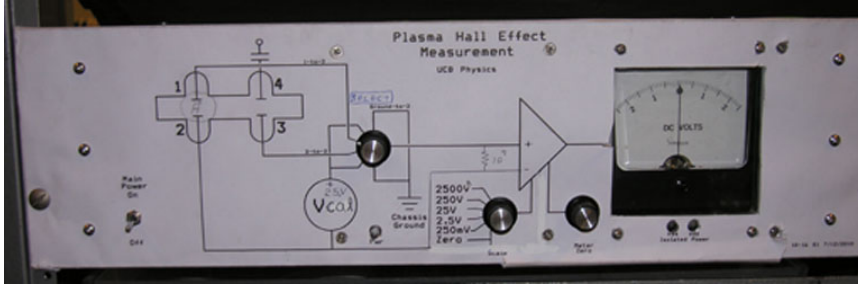


Figure 1: Hall Effect Measurement Amplifier
[Click here to see larger picture](#)



Figure 2: Hall Effect Tank Gas valves.
[Click here to see larger picture](#)

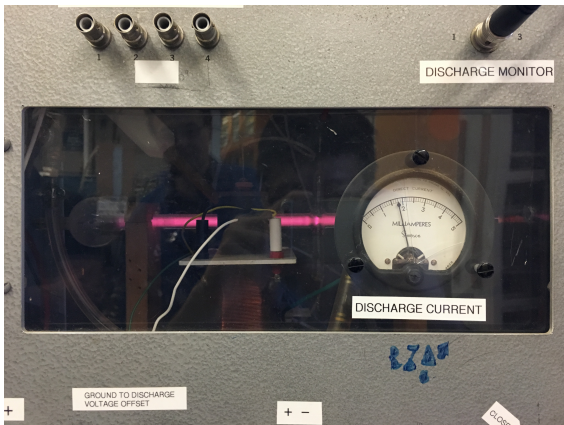


Figure 3: Plasma Discharge
[Click here to see larger picture](#)

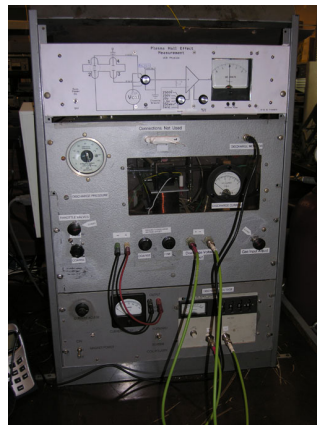


Figure 4: Hall Effect Equipment Rack. [Click here to see larger picture](#)



Figure 5: Vacuum Pressure Test TC. [Click here to see larger picture](#)

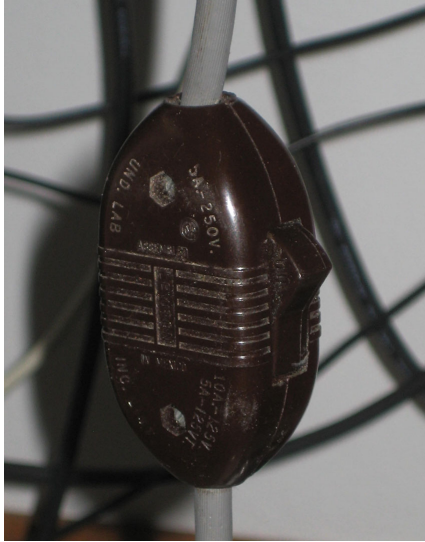


Figure 6: Vacuum Pump On/Off Switch under bench
[Click here to see larger picture](#)



Figure 7: Hall Effect Rack Experiment Area
[Click here to see larger picture](#)



Wear Your Eye Safety Glasses

4 The Hall Effect

To measure the Hall effect in a conductor we apply both electric and magnetic fields. The analysis is simplest if we take care to apply them perpendicular to each other. In the most common Hall effect geometry, we measure the current that flows in the direction of the applied electric field. We confine the carriers in the direction perpendicular to the electric field, establishing a boundary condition that this transverse current is zero. To analyze the magnitudes of the various currents and voltages that are developed in steady-state, we use some simple force balance considerations.

In thinking about the electrons in a plasma, we should be careful about the distinction between the velocity of individual electrons, \vec{v} , and the drift velocity of an ensemble of electrons $\overline{\Delta v} \equiv \langle \vec{v} \rangle$. Before we apply any fields, the electrons are moving randomly at a high speed that reflects their temperature. The average velocity of the ensemble is zero. When we apply the longitudinal electric field, the ensemble will move in the direction of the applied force, at a drift velocity that is in general much slower than the mean thermal velocity. To determine the drift velocity, we consider what happens to an electron during its motion between collision events. During this time it experiences the electric force,

$$\vec{F}_E = q\vec{E}, \quad (1)$$

where $q = -e$ for our problem. If the velocity of the electron just after its last collision is \vec{v} , then its velocity just before the next collision is $\vec{v} + \overline{\Delta v}$, where

$$\overline{\Delta v} = \frac{\tau q}{m} \vec{E}. \quad (2)$$

In the equation above, τ is the mean free time. It is also common to relate the drift velocity to the collision frequency, ν , which is just reciprocal of τ (make sure you can see the difference between \vec{v} and ν in the typography!):

$$\overline{\Delta v} = \frac{q}{m\nu} \vec{E}. \quad (3)$$

Next, we average $\vec{v} + \overline{\Delta v}$, over many collisions. As we assume that the initial velocity is random, so it's zero, then the average velocity is just given by $\overline{\Delta v}$.

The effect of the magnetic field on the electrons is a little bit trickier. In the absence of an electric field, the velocities are random, and the B field has no net effect. In other words, electrons are equally likely to be curving one way as the other. However, in the presence of drift induced by the electric field, there will be a time-averaged magnetic force.

$$\vec{F}_M = q\overline{\Delta v} \times \vec{B}. \quad (4)$$

Let's choose coordinates such that the magnetic field is along the z -axis and the electric field is along the x -axis. Under such conditions, electrons will drift in the x -direction under the influence of the applied field. The force caused by the magnetic field will therefore be in the y -direction. Note that neither E nor B will yield a force in the z -direction. As stated above, in the most common Hall geometry, we confine the electrons so that the net current in the y -direction is zero. As a result of this boundary condition, an electric field develops that balances the magnetic force on the drifting electrons. The quantitative study of the Hall effect is all about the ratio of this electric field to the applied B field.

The magnetic force on the drifting electrons is obtained by substituting the drift velocity into the Lorentz force equation,

$$F_y = -\frac{q^2 E_x B_z}{m\nu}. \quad (5)$$

To maintain a condition of zero current flow in the y -direction, an electric field given by,

$$E_y = \frac{qE_x B_z}{m\nu}, \quad (6)$$

must be established. Since physicist's love dimensionless quantities, we should consider the ratio,

$$\frac{E_y}{E_x} = \frac{qB_z}{m\nu}, \quad (7)$$

which is known as the Hall angle. Notice that familiar combination of parameters appears here. Yes, qB/m is just the cyclotron frequency, which is 1.8×10^{11} Hz for a magnetic field of 1 Tesla. A nice expression for the Hall angle is then,

$$\Theta_{\text{Hall}} = \omega_c \tau. \quad (8)$$

The analysis of the Hall effect that we have done is valid when the cyclotron frequency is smaller than the collision frequency. In this regime, the electron's motion is interrupted by collision before it can complete a cyclotron orbit.

To learn as much as we can about conduction in the plasma we should measure the longitudinal current as well as the Hall angle. The electric current density \vec{j} is given by,

$$\vec{j} = qn\overline{\Delta v}. \quad (9)$$

The resistance of plasma, which we call ρ , is the ratio of this current to the longitudinal electric field, or,

$$\rho = \frac{E_x}{j_x}. \quad (10)$$

In the longitudinal (unconfined) direction, the current is determined by balancing the force due to the applied electric field and the frictional force. This balancing act yields the following expression for the resistance,

$$\rho = \frac{m\nu}{q^2 n}. \quad (11)$$

If we can measure both the Hall angle and the resistance, this gives us two independent observables. In general, a conductor under study has four independent parameters: the density, charge, mass, and scattering rate of the mobile charged species. In the case of our plasma, the current is carried by electrons, and therefore the mass and charge are known to us. In this case our two independent observables are sufficient to determine the remaining two parameters - the density and collision rate of the electrons.

5 Hall Effect in Glow Discharge Columns

In the discussion above we assumed that the density of electrons was uniform in space. For homogeneous systems in thermal equilibrium this is a reasonable assumption. However, this is not case for the plasma. The free electrons in the plasma are produced in ionizing collisions with gas atoms or molecules confined at a low pressure in a long narrow discharge tube. At the low current densities under consideration here, recombination of the charged particles takes place almost exclusively at the tube walls. This means that the electrons (and positive ions) produced in the gas must find their ways to the walls before they disappear. The resulting electron density distribution is not uniform, but has a maximum in the center of the tube, and falls nearly to zero at the walls. When a transverse magnetic field is applied the electrons are redistributed to counteract the Lorentz force, and a Hall field is set up. This Hall field is not uniform across the plasma. Therefore, the Hall voltage, which is the integral of the Hall field, is not simply the product of the Hall field and separation of the electrodes. However, it turns out that Hall voltage that you actually measure is, in fact, exactly one-half the expected value, for the case of slab geometry. The proof of this can be found in the book by Golant et al (See [Golant Reading Materials](#)).

Armed with this knowledge, you can use the measured Hall voltage and longitudinal current density to obtain the electron density and scattering rate. As a quantitative example, we can operate a glow discharge at a current density of 10 A/m^2 in a mixture of 1% argon in helium at $p = 30$ torr pressure and find a Hall field $E_H = 300 \text{ V/m}$ when $B = 100$ gauss, and an ohmic field $E_o = 5000 \text{ V/m}$. This tells us that the electron drift speed is $u_e = 30,000 \text{ m/sec}$, and therefore the free electron density is approximately $n_e = 2 \times 10^{15} \text{ m}^{-3}$. The gas density calculated from the ideal gas law, on the other hand, is $N_g = 10^{24} \text{ m}^{-3}$, so that the degree of ionization n_e/N_g is only about 2×10^{-9} . Note: Measure the distance between the pole pieces!

While we have learned a lot, notice that we don't obtain any direct information about the thermal velocity of the electrons in the plasma. However, we can make some indirect inferences. We know the electron collision frequency and the density of the atoms that the electrons are colliding with. According to kinetic theory, the collision frequency is related by the scattering cross section for momentum transfer, that is,

$$\nu \cong N_g \sigma v. \quad (12)$$

where σ is cross section, and v is the speed of electron (More in depth explanation in W. B. Kunkel). Where In our experiment using He gas the cross section is approximately equal to $3.8 \times 10^{-20} \text{ m}^2$. Using this value for cross section and the expression above, the mean electron speed and hence the mean electron energy, or temperature can be estimated. The collision rate equation gives the average speed and the temperature is related to the mean square speed. For the MB distribution the mean square speed is not equal to the square of the average speed and you should take this factor into account. See Kittle for discussion on this point.

If you do your calculations correctly, you should obtain some rather large electron speeds and temperatures. The electron temperature T_e can exceed 10,000K. You might be wondering if you should keep your hands off the glass tube that encloses the plasma. In fact, the glass is only barely warm to the touch. What is this telling about the nonequilibrium state in the plasma? A hint is that it should be related to the efficiency of energy transfer from the electrons to the He atoms. Can you explain why the thermal contact between the free electrons and the background gas is so weak? It can also be shown that the energy in random motion of the free electrons has an upper bound given by

$$\text{Energy} = \left(\frac{1}{2}\right) m \langle v^2 \rangle < \left(\frac{1}{2}\right) M_g \Delta v^2 \quad (13)$$

where Δv denotes again the **drift** speed and M_g is the mass of the gas atom or molecule. The upper limit is reached when electron energy loss due to inelastic collisions (excitation and ionization) is negligible compared to that caused by elastic collisions. A substitution of the mass of the helium atom and the electron drift speed of our example into eq. (13) yields an energy upper limit of 18 eV.

Although 1 eV is very much higher than the thermal energy of the gas, it is much lower than most ionization energies. The ions produced in our gas mixture are primarily argon, which has an ionization energy of 15.8 eV. How can ionization take place when the mean electron energy is much lower than the energy required to

liberate an electron from the gas atoms? You may have noticed that in the steady state, a local rate balance between ionization and recombination at an electron temperature of 10,000K and at the densities quoted here, the degree of ionization should be very high rather than the very low level observed. The explanation is that the loss of ions in these discharges at low gas pressures is controlled by transport to and recombination at the relatively cool walls. This is a second and equally important process causing pronounced deviations from equilibrium conditions.

The matter of energy balance and of charged particle production, transport, and loss are thoroughly discussed in the texts on ionization phenomena in gases. The steady state condition for the column of a glow discharge is a delicate balance between several non equilibrium processes. It is not surprising that such columns display a variety of oscillations and non-uniformities that sometimes interfere with our Hall effect observations and therefore deserve some attention.

Checkpoint Mean Electron Energy:[†] Discuss the following questions with you partner and once you feel you have a better understanding of what is happening, call over a GSI to sign you off: How can ionization take place when the mean electron energy is much lower than the energy required to liberate an electron from the gas atoms?

6 Instabilities, Oscillations, and Striations

Plasmas are in general unstable entities. If plasmas were intrinsically stable, plasma fusion reactors could already be supplying commercial electricity, but they are not. The stability of a plasma is dependent on almost anything imaginable, not only the obvious: current, voltage, pressure, magnetic field and mass flow rate; but potentially also the non-obvious: contaminant gases, ambient temperature (untested), ambient light (not observed), and time (very important). It is characteristic of all plasmas that they can support many types of waves. Some of these waves grow spontaneously from thermal fluctuations to large amplitudes. In that case they are called instabilities. Most instabilities in our discharge are driven by the electric current, somewhat like whistle tones are excited by air streaming through pipes. A small change in current or in gas density can change the oscillatory behavior completely. Therefore, pay attention and don't change the gas pressure or flow in the middle of taking a set of data.

You should have read the articles on **Striations**

Observations reveal that oscillation frequencies are in the multi-kilohertz range, with amplitudes sometimes in excess of a few volts. It is therefore important that measuring devices be protected by low-pass filters consisting of RC input circuits with about 0.2 sec time constants. Quiescent (oscillation-free) operation is a necessity for all measurements. You may have to invest some time finding a stationary state, by varying the current, gas pressure, and flow rates. Patience is needed. The gas is a mixture of helium with 1% of argon and 0.1% of nitrogen. The argon is most easily ionized and supplies most of the free electrons, while the nitrogen is added to make the entire mixture relatively insensitive to contamination by air and other residual impurities. A small flow rate is required to keep the mixture constant. Too rapid a flow causes turbulence in the gases.

Under many operating conditions, particularly at the lower pressures, a striking stationary structure appears in the visible glow consisting of alternating bright and dim regions or striations. These can be considered as large-amplitude ionization waves. The amplitude modulation of the luminous intensity, which may approach 100%, is much larger than the axial variation of electron density which rarely exceeds 20%. It turns out to be primarily caused by the variation in the tail of the electron energy distribution which is responsible for most of the visible radiation. The effect on our Hall voltage is therefore only minor, and we can ignore the presence of stationary striations for our purposes. The effect on E_o is also minor if the distance between probes is made large enough to permit averaging over several wavelengths of these striations.

7 Apparatus and Equipment

1. The equipment required for this experiment is contained in the Plasma Hall Effect rack. The labels on the rack controls are intended to faithfully reflect the descriptions in this text, though schematic labels in the text and on the gas flow diagram are NOT attached to the physical valve handles. Rather, physical valve handles are labeled on the rack corresponding to their functional description, such as “Gas Input Adjust” (for valve v2).
2. The gaussmeter, an oscilloscope (any scope with a 1M input will do), the gas supply cylinder (right side) and the **vacuum pump** (under the bench) are the required components that are external to the Plasma Hall Effect rack.
3. The schematic diagrams of the gas flow system, the plasma electrical measurement system (including supplies, meters, and the discharge tube), and the magnet circuits, are included in the following sections. These systems are functionally independent though they all affect the plasma and its characteristics.
4. The impedances of the supplies and the meters are explicitly identified to assist the experimenter in identifying potential measurement errors. Like most physical experiments utilizing electrical measurements, the results depend on the interaction of a non-ideal physical construction (the discharge tube containing the plasma) with non-ideal electrical instruments. The thoughtful experimenter is mindful of these interactions, taking care to minimize the deleterious effects on the measurements. The instruments perturb the physics.

8 Equipment Notes

8.1 General, the gas and the plasma

The vacuum and gas supply system, including the line between the inflow needle valve and the high-pressure regulator, is leak-free enough to permit a base vacuum pressure below 2 mm of mercury (2 Torr) pressure. However, due to back-pressure after shutting off the pump and closing the valves, pressure will build up in the system at a rate of ~ 1 Torr per 11 minutes, which is insignificant. So, when shutting off the system and returning at a later time, don't be alarmed if there is a high pressure reading on the gauge. Glow discharges are sensitive to contamination, especially by organic vapors, and this plasma discharge tube is no exception. Considerable flushing (flowing gas through the discharge tube with the plasma established) helps establish a stable plasma discharge characteristics. The longer the duration of a plasma discharge, the more stable and reproducible the discharge conditions become and the wider the discharge operating range in pressure (up to 30 Torr) and current (below 0.3 mA).

The settling time of the plasma that is to a stable current-voltage, and noise operating point may be several minutes. As a result of this long settling time, the plasma control parameters: pressure, flow rate, and discharge voltage need to be changed slowly while monitoring the plasma response parameters discharge current, plasma physical appearance (striations), discharge current/voltage noise at the discharge monitor. If the control parameters are changed too quickly, one of the most common and annoying results is that the discharge extinguishes and the control parameters need to be returned to a starting point.

As a guideline, changes to pressure should be slower than 1 Torr every 10 seconds and the voltage changes 100V in 5 seconds.

The color of the glow is sensitive to gas composition, which for the helium/argon/nitrogen mixture used in this experiment, is pink. Although the system is leak tight, it is desirable to keep the gas pressure upstream of the input valve (labeled “Gas input adjust”) slightly above atmospheric pressure in order to prevent air from entering the gas system between the input valve and the gas regulator. This higher pressure has the disadvantage of operating with a large pressure drop across the input valve, thereby making the plasma discharge pressure very sensitive to the setting of this valve. On the other hand, once the input valve conductance is set, a nearly constant gas flow rate has been established.

8.2 How to set a gas pressure and gas flow rate

This section is good to read (but not yet carry out) before following the procedure in section 12. The drawing below (see Fig 8) illustrates the complete plasma discharge gas flow system, which is similar to other low pressure gas delivery systems. A gas source (He/Ar/N tank) supplies gas at about 5 psi (~ 1000 Torr at p_2 where units are kg/cm²). The discharge tube pressure (p_3) is nominally 10-30 Torr so that valve v_2 conducts gas at a nearly constant rate determined by the ~ 1000 Torr differential pressure valve v_2 's conductance G_2 . G_2 is a needle valve with relatively low conductance. This procedure establishes a constant gas flow rate into the discharge tube.

The rotary-vane vacuum pump has a very high evacuation capacity and would require a significant gas flow through v_2 to achieve the proper discharge pressure at p_3 . It is common practice to insert a "throttling" valve (v_4 & v_5) between the vacuum pump and the discharge tube to allow reduce the effective evacuation capacity, effectively throttling the vacuum pump. The throttling valve allows a pressure differential between the vacuum pump (~ 0 Torr) and the discharge tube (p_3 , 10-30 Torr).

When the pressure in the discharge tube is stable, the gas inflow equals the gas outflow. With valve v_5 closed then $(p_2 - p_3) \times G_2 = (p_3 - 0) \times G_4$. With $p_2 = 1000$ Torr and $p_3 = 10$ Torr, the ratio of valve conductance, $G_4/G_2 \sim 100$. That is, the conductance of valve v_4 has to be 100 times that of valve v_2 , or practically stated, needle valve v_2 will be almost closed while valve v_4 will be significantly open.

To avoid damaging the valves in the Hall plasma system and as general information, some guidelines should be observed. All the accessible valves are right handed, that is they close when turned clockwise. Only hands without tools should be used to adjust valves. Valves v_2 , v_3 , and v_5 can be closed with one finger and a thumb. Valve v_1 , on the top of the gas cylinder requires a full grip to open and close (and considerable torque), but only needs to be opened and closed about 1/4 turn. It is very important to close v_1 when the experiment is not in use. Each gas cylinder is a ten-year supply. So why is there a spare cylinder of gas?

The gas regulator, r_1 , attached to the gas cylinder, and controlled by the large black knob, does not normally need to be adjusted. When v_1 is open, p_1 should indicate 100-2000 psi and p_2 indicate 4-6 psi. If for some reason p_2 is not 4-6 psi when v_1 is open, first tap on the regulator r_1 and gauge p_2 with your knuckle. If p_2 still does not indicate a pressure of 4-6 psi, the pressure at p_2 may be increased by slowly turning the black knob (r_1) clockwise. If the pressure is too high, a counter-clockwise rotation of the black knob of r_1 will reduce the pressure at p_2 ONLY if the gas has someplace to go. Therefore, before turning the black knob to adjust p_2 , it is required to have the vacuum pump on and v_2 and v_4 both open 1/4 turn.

There are two techniques for establishing a flow and a pressure with this gas flow configuration. The first technique is the more traditional of the two: set flow (v_2) then set pressure (v_4) at constant flow. The second technique is a non-constant flow required to reach discharge pressures in the 12-35 Torr range and requiring a higher conductance than v_4 can provide using the first technique. The second technique requires that the discharge is established AND then the flow AND pressure are increased.


With v_5 and v_2 closed, open v_4 3 turns (3.5 turns is all the way open) and wait about 30 seconds, p_3 should read about 1 Torr.

Technique 1: Open v_4 by 1/2 turn, open and adjust v_2 until p_3 , "discharge pressure", indicates 10 Torr. This is the low gas flow set point. Do not change v_2 as the flow rate is set. Open v_4 2 turns and enable the discharge voltage.

Technique 2: Open v_4 3 turns, open and adjust v_2 until p_3 , "discharge pressure", indicates 15 Torr. This is the fixed conductance point of v_4 . Do not adjust v_4 . The gas flow through v_2 and v_4 is proportional to p_3/G_4 . Enable the discharge voltage. To increase the discharge pressure, open v_2 which will increase p_3 and the flow rate proportionally.

8.3 How to set a gas pressure

This section is good to read (but not yet carry out) before following the procedure in section 12. First pump out the system with the coarse pump-out valve open, on the left side of rack, then open the

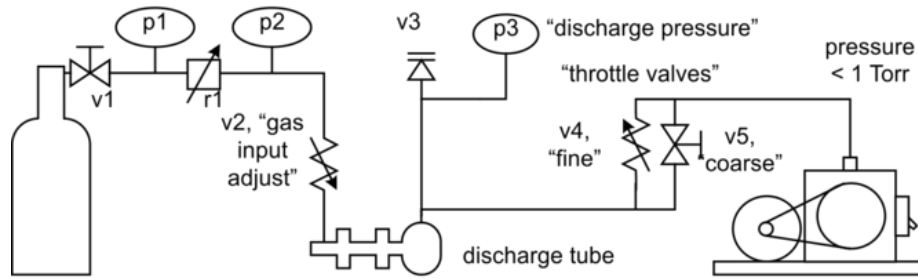

- v1, valve integral to the top of the gas cylinder
- p1, cylinder pressure, 100-2000 psi, change at 100 psi
- r1, Matheson regulator, set for 5 psi on p2 when v1 open
- v2, gas input needle valve, conductance G2, sets gas flow rate
- v3, discharge tube relief valve (not adjustable)
- p3, discharge tube pressure, (0-50 Torr Wallace & Tiernan)
- v4, gas outflow needle valve, conductance G4, sets discharge tube pressure
- v5, gas outflow valve
- For p2 ~1000 Torr & p3 ~10 Torr, G4/G2~100

Figure 8: Plasma Discharge Gas Flow System

Gas Input Adjust valve on the right side of rack one turn, with the main gas cylinder tank closed. When the vacuum meter reads near zero, close the main coarse pump-out valve (Throttle Coarse) and open all the way the needle valve (Throttle Fine) on the pump-out side of the system (NOTE: these two valves are in parallel). Now open the cylinder tank main valve and adjust the pressure meter to read above 1 lb. Time to adjust the gas inlet valve on the right side of rack to the lowest pressure you want for the first pressure set point. Now adjust the pump-out needle valve for the other pressures you want for the experiment.

Acceptable discharge conditions – the oscilloscope showing no fluctuations larger than 0.1 V – can be produced at pressures between 3 torr and 35 torr, with currents between 0.5 and 2 mA. At the low-pressure end of this range stationary striations are very pronounced and can interfere with the measurements. So keep the current low if possible. Some modest stationary striations (relatively small intensity modulation) are visible over most of the range but are mild enough not to distort the reading of E_o and E_H by more than 10%. The conditions can be kept reproducible by maintaining a very small flow rate which replaces the gas content of the tube about every five seconds.

It is essential that the discharge **power supply** have a floating ground connection so that the Hall probes can be kept close to ground potential by means of the potentiometer bridge arrangement. *See the Circuit Diagrams.* The reason for this requirement is the following: the effective contact impedance between a small probe and a low density plasma is several mega-ohms. It is also nonlinear, increasing rapidly when drawing primarily ion current from the plasma. The leakage resistance of standard cable connectors and feed-through insulators is between 10^9 and 10^{10} ohms. If either the cathode or anode were at ground potential, the probes and Hall measuring circuits would be at positive or negative potentials of about one kilo-volt, and unwanted probe currents would be quite large. The biasing potentiometer, which adjusts the potential of the probes, needs adjustment each time a discharge parameter is changed. When this precaution is taken, good linear relationships are found between the Hall probes and the B-field up to at least 200 gauss in either direction. Observed deviations from the linear relationship given in eq. (4) at higher magnetic fields are presumably caused by magnetically induced distortions of the discharge. When the field is too strong the visible appearance of the glow between the pole faces is noticeably changed, indicating excessive deviations from axial symmetry.

Checkpoint Valves and Probes:[†] Discuss the following questions with you partner and once you feel you have a better understanding of what is happening, call over a GSI to sign you off: Locate the valves and probes from the plasma discharge gas flow system depicted above and

explain how they affect the pressure in your discharge tube.

9 Plasma Discharge and Associated Electrical Instruments

The discharge tube containing the plasma is powered through a 0-3 kV supply “discharge voltage” that is voltage referenced to the chassis (earth) ground through a resistor divider, the ground-to-discharge voltage offset. This offset voltage as well as the potentials of the discharge electrodes 1 and 3 can be measured by means of a high impedance (10^9 ohms, < 100 pF), bipolar voltmeter with full scale voltages of 2500 V to 250 mV as illustrated below. Electrode 4 is capacitively coupled to an external oscilloscope to monitor the discharge stability via the “discharge monitor” port.

The voltmeter, pictured as an ideal amplifier with 10^9 ohm input impedance, can be connected to either of 4 connections via a low-leakage current relays. One connection is to a 25 V calibration voltage. The other 3 connections are to electrodes 1, 3 and the chassis ground. The return voltage to the voltmeter, or the reference voltage, is electrode 2. Note that the connection to electrode 3 is via a 10^{10} resistor.

The voltmeter may be zeroed by selecting the “zero” range on the voltmeter range selection switch and rotating the “meter zero” knob. This is the only configuration in which the voltmeter should be zeroed. The discharge current should be zero during this operation.

Another point worth noting is that the discharge voltage is connected to the discharge tube via 0.5M ohms. This resistance effectively limits the discharge current to 6 mA if the plasma resistance were 0 ohms. However, as the minimum voltage across the discharge tube required to sustain plasma is about 1.5 kV, the discharge current is effectively limited to about 3 mA.

10 Procedure

10.1 Turning on the system

1. Check all electrical and gas flow connections. All gas valves must be closed, all electrical power off.
2. Turn on the pump.
3. Open the pump-out valve (Throttle Valve Coarse v5) (see Fig 8). Vacuum gauge should go down towards 2 Torr (It may take about 2-4 whole turns). If not, call a Staff person and ask for help.
4. Open the main valve v1 and coarse valve, this is the one to the right of p1 and p2, on He supply tank. **ASK IF YOU DON'T UNDERSTAND WHAT EACH KNOB OR HANDLE DOES, OR WHAT THE GAUGES MEASURE.** The high-pressure gauge P1 should read between 100 and 2,000 lb/in² (psi) pressure. If the tank pressure is below 50 lb/in², get a new bottle. (Call for assistance from the staff)
5. Close the pump-out valve (Throttle Valve Coarse, you should know this one by now). With this step you are checking for a leak. If the pressure in the discharge tube rises rapidly, there is likely a leak, and you should get help.
6. Open the outflow valve (Throttle Valve Fine) 1 turn.
7. Open the “Gas Input Adjust” needle valve, VERY SLOWLY about 1/4 turn, or until discharge pressure rise is very noticeable though below 45 torr. If pressure does not increase, you may need to adjust the regulator valve, r1, of the gas cylinder until P2 reads 6 psi (above 0, not the 6 marking below 0).
8. Adjust the pump-out needle valve (Throttle Valve Fine) to obtain steady conditions between 10 and 20 Torr pressure (lower pressures work better). At this point if your pressure can't be adjusted you may have opened v2 the “Gas Input Adjust” a little too much. Once a small flow rate is established it is best not to touch the input valve again, but to do all regulation with the outflow needle valve

(Throttle Valve Fine). It permits much finer adjustment because the pressure drop across it is much smaller.

9. After a few minutes of steady flow, turn on the high voltage to about 2,500 V. There will be a discrepancy between the voltage value read on the kilovolt meter and the value set on the knobs, but the turnable knobs used to set the high voltage is the true indicator of actual voltage being applied, and the meter is just a reference. There should be a glow, purplish pink in color, and the ammeter should read about 1 mA. Think about how can the pressure in the tube may affect your discharge current.
10. Turn on the oscilloscope, to monitor the fluctuations in the plasma potential by means of the grounded probe. Under proper conditions, oscillations should be much smaller than 0.1 V, perhaps 50 mV peak-to-peak. If oscillations are too large, change the gas pressure, flow rate, high-voltage setting, etc. until quiescent operation is found. If unsuccessful, turn discharge off for one minute, then start it again. The start-up voltage may have to be higher than the operating voltage, particularly at the higher pressures. Repeat the process a few times if necessary. If oscillations are still too large, get help.
11. If all is well, turn on the probe circuits with the voltmeter range setting at 250 V or 2500 V. Leave the magnet power off. **DO NOT USE THE DVM.**
12. Adjust the discharge ground (grounded probe) with the potentiometer so that probe #2 floats near the ground potential using dials on the front panels. First, make sure the operational amplifier is properly adjusted to give the correct reading. Set 'Scale' to zero, then adjust 'Meter Zero' until the adjacent voltmeter gives a zero reading. Set the 'Select' dial to 'Ground-to-2' and 'Scale' to the appropriate scale. Then, use the 'Coarse' and/or 'Fine' dials of the potentiometer (labeled as 'Ground to discharge voltage offset' on the front panel) to adjust the ground to probe #2. If conditions are steady, this probe floating potential will not drift by more than a few volts (a fraction of one volt on our meter) in several minutes. Every change in conditions requires a potentiometer adjustment, however.

Checkpoint Stable Plasma Flow:[↑] **Discuss the following questions with you partner and once you feel you have a better understanding of what is happening, call over a GSI to sign you off: Establish a stable plasma flow by following one of the two techniques listed in section 10.2. Which technique do you prefer to use at 30 Torr?**

10.2 Shutting off the system

1. Shut off the probe circuits and oscilloscope. Turn off the magnet power and discharge high-voltage power supply.
2. Open the pump-out valve.
3. Close the main valve on the helium gas cylinder to stop flow into the system.
4. Open the inflow valve until discharge pressure reads 30-40 torr. The discharge pressure should then decrease as the gas gets pumped out. When the discharge pressure falls enough, you can open the inflow valve to reach 30-40 torr again. Repeat this until discharge pressure reads 0.5-2 torr and the inflow valve is completely open.
5. If all the gas is evacuated from the lines, P2 should reflect this too. It usually reads 10 psi **below** 0 psi. This is a confusing gauge. P1 should also read near 0 psi.
6. If the discharge pressure and P2 readings show the system is pumped out, then close the inflow valve.
7. Close the outflow valve (both fine and course). Turn off the pump.
8. As stated above, there will be a slow back-pressure that builds up in the tube, but do not worry about this as long as it is below 4 torr.

The system is now shut down, but call for help if there are any problems. The main thing to be careful of is putting a pressure greater than atmospheric in the discharge tube. There is an automatic relief valve, but if it fails to operate – as it has in the past – the glassware explodes.

Checkpoint Shut Off the System Completely:[†] Discuss the following questions with you partner and once you feel you have a better understanding of what is happening, call over a GSI to sign you off: Show you understand how to shut off the system completely and why it needs to be done that way. You do not have to turn off the system but simply supply your instructor with enough information to display you understand why we must take these safety precautions.

10.3 Measurements

1. I_d and V_d : The purpose of these first measurements is to illustrate some of the interesting properties of a plasma discharge. For a range of discharge tube pressures between 15 and 30 torr, measure the discharge current, I_d , and the discharge voltage, V_d , as a function of high voltage. The discharge voltage is given by the potential between probes 2 and 3. Note that there is a 10^{10} ohm resistor in series with probe 3, to keep current flow around 10^{-8} A. Before you take data, play around with the high voltage, discharge current, gas pressure, and gas flow, in order to get a feel for the limits on the parameters. When taking data, a typical procedure is to set the pressure to 15 torr, set the high voltage somewhat higher than it takes to keep the discharge going properly, measure the current, and record it and the voltage. Then increase the current by adjusting the high voltage, and again record the current and voltage. Repeat until you have enough points to plot a curve. Now change the pressure to 20 torr, and repeat. Continue until 6 pressure plots are obtained. Think about what you are doing, and what other data you might need. What do you need to know to go from current to current density, from power supply voltage to discharge tube voltage, etc.?

2. B vs. I_m : Using the gauss meter model 5180 with the HIGH VOLTAGE SUPPLY OFF, measure the magnetic field strength as a function of magnet current for both directions of magnet current flow (measure both the FORWARD and REVERSE directions of magnet current flow – just flip the COIL POLARITY switch into the correct position).

1st = Select Auto Zero. To select AUTO ZERO operation, press the ZERO pushbutton. Unit automatically returns to normal operation. 2nd = Select Auto Range. To select AUTO RANGE operation, press the SHIFT pushbutton followed by the RANGE pushbutton. Press the SHIFT pushbutton followed by the RANGE pushbutton to exit Auto Range mode. Manual Range. Also; To select MANUAL RANGE operation, press the RANGE pushbutton. Press the UP (5) and DOWN (6) arrow pushbuttons to select ranges. Press the RANGE pushbutton to return to normal operation. For a complete Manual See [\[FWBell 5180 Gaussmeter\]](#) For an interactive Manual see [\[5180Manual.exe\]](#) See the Circuit Diagrams for more details from the schematic. Plot B as a function of I_m . Does the magnet display significant hysteresis? See the Hysteresis page.[\[Hysteresis\]](#)

Is the B-I relationship linear? Does it depend on the history current in the magnet? Historically, characterizing this was important because we did not have a Gaussmeter that could operate with the high voltage on and it was necessary to infer the B field from the applied current. Fortunately, in the current apparatus, you can simply read the B field while the Hall Voltage measurement is being made, rather than having to infer it from the current.

3. E_H vs. B . For a gas pressure of ~ 20 torr, adjust the supply voltage to obtain a stable discharge with a current of ~ 1.5 mA. Measure the Hall field between probes 1 and 2 as a function of magnetic field (note that probes 1 and 2 are about 8 mm apart). Take data for the full range of magnet current (both polarities). Remember to keep the probes near ground potential by adjusting the potentiometer. Plot your results. Is E_H linearly dependent on B? In general E_H can have a large offset due to subtleties such as small lateral misalignment of the probes. However, this offset is generally constant and can be neglected to find the quantity, dE_H/dB , on which the plasma properties depend. For the linear parts of your data (usually B less than 300 gauss) calculate quantities describing the electron gas (v_e , n_e , ν_e , $\langle\sigma v\rangle$, T_e , etc.). Are your results reasonable?

4. Pressure and current dependence. We would like to study how the plasma properties depend on the gas pressure and discharge current. Because the discharge voltage is nearly invariant with changing current, the discharge current is a good proxy for the electrical power being dissipated in the plasma. You will find that there is a finite range of current at a given gas pressure where a stable plasma can be obtained. Choose values for pressure and current in the middle of the stable range. Keeping current fixed, repeat the measurement of the plasma parameters for several (~ 5) different values of pressure ($\sim 10 - 30$ torr). Then, fix the pressure to the middle value and choose several values of current (~ 5) over the range where a stable discharge can be achieved. Do a range of E_H vs. B measurements at these different currents too. Determine the plasma parameters for each of these measurements. In this way it is possible to see how plasma parameters respond to changes in pressure and discharge current.

Checkpoint Hall Electric Field vs. Magnetic Field Plots:[†] Discuss the following questions with you partner and once you feel you have a better understanding of what is happening, call over a GSI to sign you off: Show the your measurements of the Hall-voltage as a function of the magnetic field taken at various pressures/currents and explain your results in the light of the above questions.

10.4 Glow Discharge Structure

Below shows the Voltage-Current curve of self-sustaining glow discharge. Notice the Normal Glow Region which is linear. This is the region where probes 2 and 3 are located. The voltage here should be linear and constant.


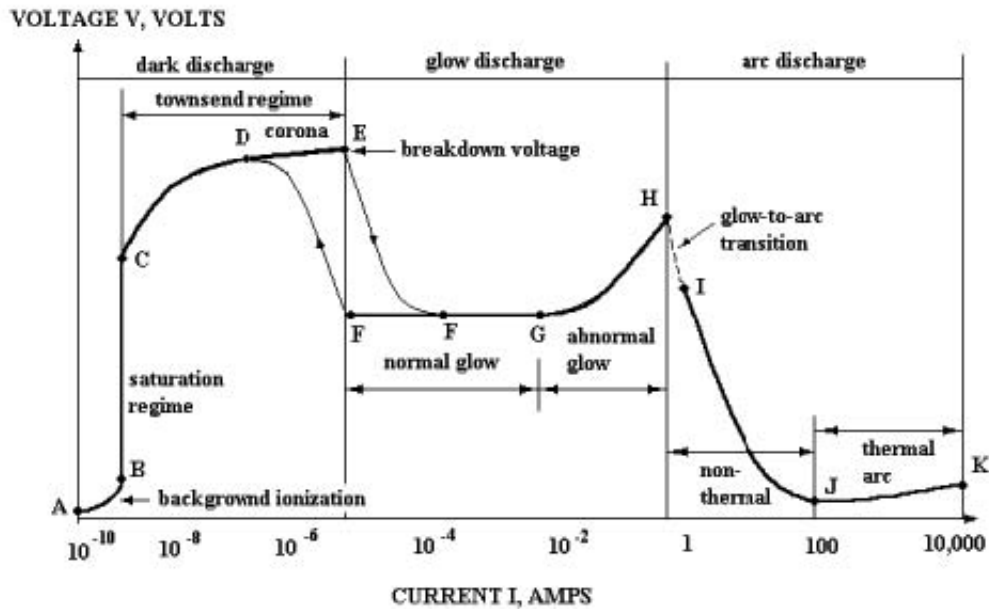


Figure 9: Voltage vs. Current curve of self-sustaining glow discharge


- Last day of the experiment please fill out the [Experiment Evaluation](#)

Copyright © 2015 The Regents of the University of California. All rights reserved.

11 Hall Effect tube and magnet electronic diagram

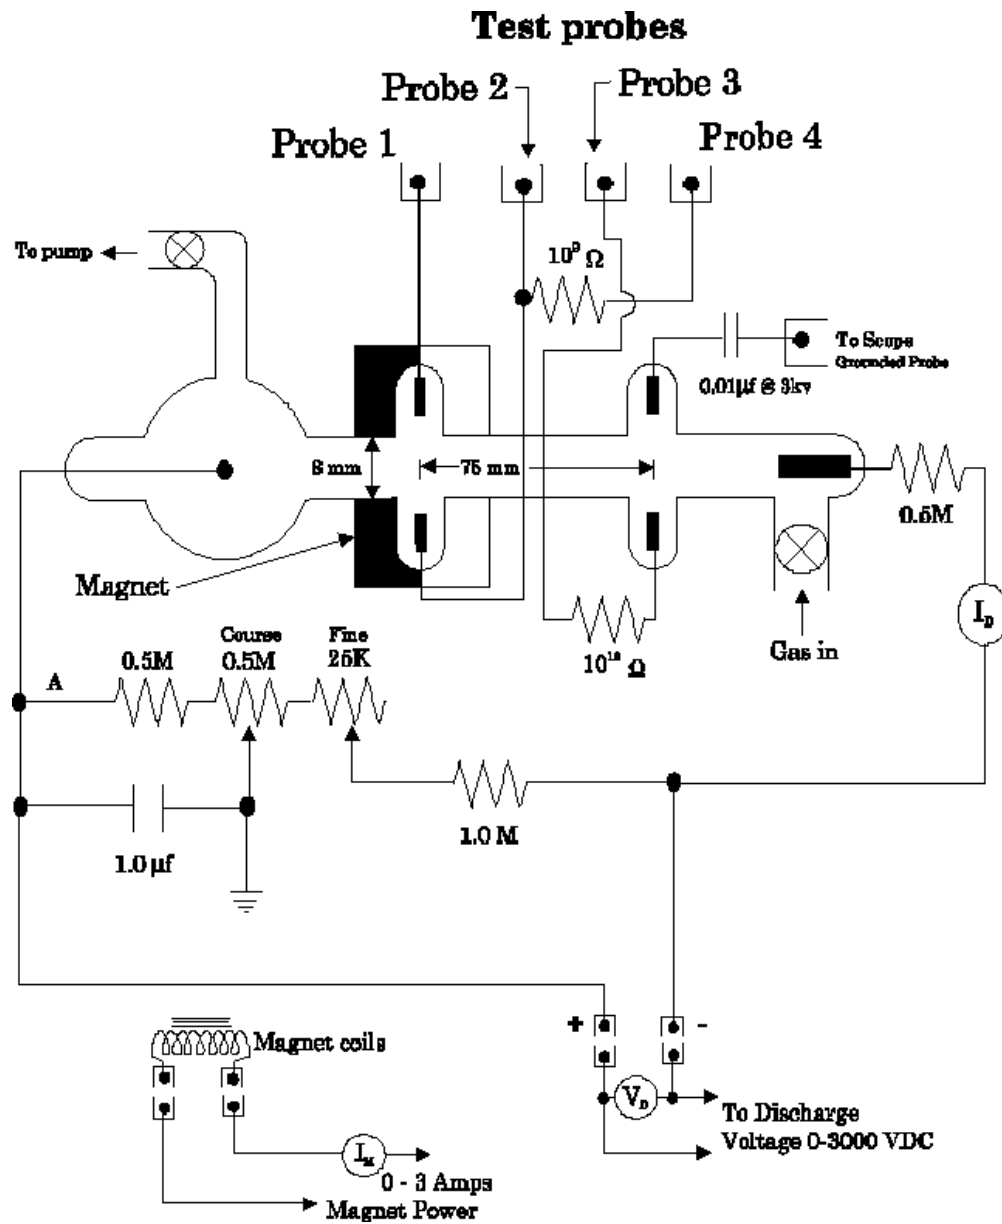

12 Hall Effect Magnet Power Circuit Schematic

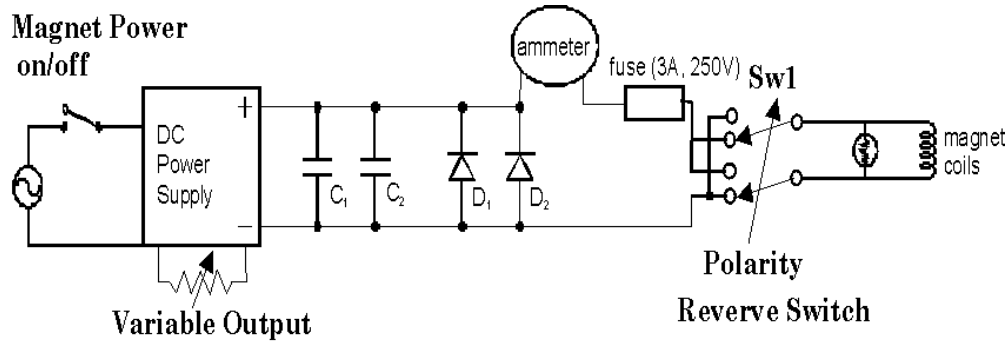

$C_1 = C_2 = 4000 \mu\text{F}$
 $D_1 = 1\text{N}4007$
 $D_2 = 1\text{N}5243\text{B}$
 (13V, 1/2W zener)

13 Suggested Reading

1. W. B. Kunkel, "[Hall Effect In A Plasma](#)", *America Journal of Physics* 49, 733 (1981).
2. Golant, V.E. and et al. "[Chapter 5](#), [Chapter 7](#), [Chapter 8](#), and [Symbols](#)." *Fundamentals of Plasma Physics*, Wiley, New York (1980).
3. M. N. Hirsh, and J. J. Oskam, eds., "[Ch. 2 Glow Discharges at DC and Low Frequencies](#)." *Gaseous Electronics*, Vol 1. Academic Press, New York (1978). *A good book on Plasma Discharge structures.*
4. Lyman Spitzer, *Physics of Fully Ionized Gases*. 2nd Ed., Wiley, New York, (1962). A very readable introduction to plasma physics (this is a simple general reference to read), which **should be read to understand the basic concepts of Plasma discharges.**
5. Read about Striations; A.V. Nedospasov, "[Striations](#)", *Soviet Physics Uspekhi* 11, 174-187 (1968).
6. [Hall Effect, Melissionos 2nd ed.](#)

14 References

1. Brown, S.C. *Introduction to Electrical Discharges in Gases*. Wiley, New York. 1966.
2. Hirsh, M.N. and Oskam, H.J. "[Chapter 2: Glow Discharges at DC and Low Frequencies](#)." *Gaseous Electronics Volume 1: Electrical Discharges*. Academic Press. 1978.
3. Golant, V.E. et al. *Fundamentals of Plasma Physics*. Wiley, New York (1980).
 - [Chapter 5: Distribution of Charged Particles in Electric Field](#)
 - [Chapter 7: Transport Processes in Plasma without Magnetic Field](#)
 - [Chapter 8: Motion of Charged Plasma Particles in Magnetic Field](#)
 - [Symbols](#)
4. Franklin, R.N. *Plasma Phenomena in Gas Discharges*. Page 48. Clarendon Press, Oxford. 1976.

5. Kittel, C. *Introduction to Solid State Physics*. Pages 287-289. 4th Edition. Wiley, New York. 1971.
6. Kittel, C. and Kroemer, H. *Thermal Physics, Second Edition*. W.H. Freeman and Company, New York. 1980.
7. Lorrain, P. and Corson, R.D. *Electromagnetic Fields and Waves, Second Edition*. Pages 299-301. W.H. Freedman. 1991.
8. Pekarek, L. “**Ionization Waves (Striations) in a Discharge Plasma.**” *Soviet Physics Uspekhi*. Volume 11, Number 2. Pages 188-208. September, 1968.
9. Chen, F. *Introduction to Plasma Physics and Controlled Fusion, Second Edition. Volume 1: Plasma Physics*. Plenum Press. 1984.
 - **Chapter 1: Introduction**
 - **Chapter 5: Diffusion and Resistivity.**
10. **Additional References and Resources**